

SERVICE BULLETIN 45

SUBJECT: POSSIBLE INCORRECT RUDDER PEDAL CENTER SUPPORT BRACKET

APPLICATION: All Glasair II RG aircraft shipped prior to 10/21/87

MANUAL REFERENCE: Glasair II RG Instruction Manual, FIGURE (D-77) page D-126

DESCRIPTION: Glasair II RG kits shipped prior to 10/21/87 may have incorrectly included a a Glasair III rudder pedal center support bracket rather than the Glasair II RG center support bracket. The support bracket for the Glasair III (P/N 472-3121-101) looks similar, but is approximately 3/4" shorter than the bracket for the Glasair II (P/N 471-0185-101). The difference in height is due to the different sizes of the nose landing gear boxes on which the brackets are mounted. Use of the shorter (P/N 472-3121-101) bracket on the Glasair II will result in reduced rudder pedal clearance from the upper surface of the forward belly panel.

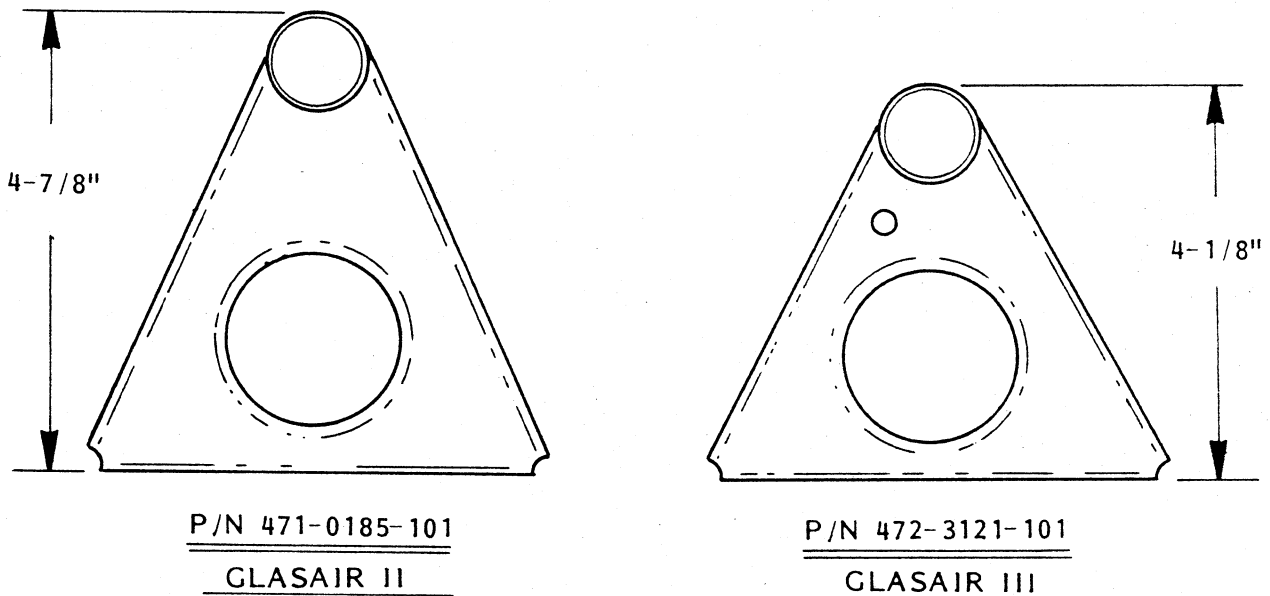


FIGURE (1)

SOLUTION: Check the rudder pedal center support bracket supplied with your kit against the dimensions provided in FIGURE (1). If you have received the incorrect center support bracket (P/N 472-3121-101), return it to Stoddard-Hamilton Aircraft's Shipping department by 12/31/87 and the correct (P/N 471-0185-101) center support bracket will be sent to you.

NOTE: If you have already installed the rudder pedal assembly using the shorter center support bracket, contact our Builder Support department for assistance.

H
STODDARD-HAMILTON
AIRCRAFT, INCORPORATED

| MODEL | ASSEMBLY NAME | REVISION | DATE | VOLUME | PAGE |
|---------|---------------------|----------|----------|--------|------|
| GLASAIR | SERVICE BULLETIN 45 | | 10/29/87 | | 1 |