

SERVICE BULLETIN 110

SUBJECT: II-S FT Outboard Main Gear Strut Attach Bracket Installation

APPLICATION: Glasair II-S FT Upper Outboard Main Gear Strut Attach Brackets
Shipped Before 3/10/92

DESCRIPTION: Some of the upper outboard main gear strut attach brackets (stock number 371-5312-001) shipped recently are too wide to be installed into the outboard rib attach brackets when assembled properly with the lower main gear strut attach brackets and NAS77-8-25 bushings. Refer to FIGURE (C-114) on page C-151 for an illustration of this assembly.

SOLUTION: If your upper main gear strut attach brackets are too wide, press one of the NAS77-8-25 bushings into the upper and lower strut attach brackets from the inside of the assembly rather than from the outside as shown in FIGURE (C-114). Install an AN960-816L thin washer (supplied with this service bulletin) between the strut attach bracket assembly and the outboard rib attach bracket where the bushing flange would normally have been located. Stoddard-Hamilton Aircraft has added the AN960-816L washers to our stock for those builders who might need them in the future.



MODEL GLASAIR II-S	ASSEMBLY NAME FT SERVICE BULLETIN 110	REVISION	DATE 4/15/92	VOLUME	PAGE 1 of 1
-----------------------	--	----------	-----------------	--------	----------------