


**SERVICE BULLETIN 145**

**SUBJECT:** Glasair III Rod-End Bearings (Part Number 170-0110-003)

**APPLICABILITY:** 170-0110-003 rod-end bearings shipped to Glasair III builders before 6/30/96 (through kit serial number 3308)

**DISCUSSION:** The affected rod-end bearing, which is used in the Glasair III cowl flap installation, may lack the two small inspection holes that are necessary to determine if the rod-end is threaded a sufficient distance onto its actuator rod.

**REQUIRED ACTION:**

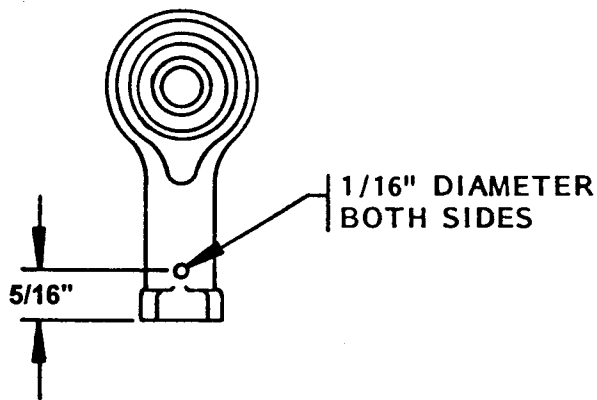

**ROD-END BEARING MODIFICATION**

Any rod-end bearing without inspection holes must be modified to permit verification of adequate threading onto the control actuator rod. Using a 1/16" bit, drill holes through both sides of the rod end bearing 5/16" from the threaded end of the bearing, as shown.



MODEL GLASAIR III	ASSEMBLY NAME SERVICE BULLETIN 145	REVISION	DATE 7/30/96	VOLUME	PAGE 1 of 1
----------------------	---------------------------------------	----------	-----------------	--------	----------------