

SERVICE BULLETIN 148

SUBJECT: Mislabeled CoNap and DMA promoter

APPLICABILITY: CoNap [P/N 270-0135-001] and DMA [P/N 270-0135-002] shipped between 10/21/96 and 11/18/96. The following kits are believed to have been affected:

115	727	1115	2138	2246	2321	2369	3135	3251
240	784	2045	2145	2269	2325	2372	3178	3259
526	795	2054	2215	2275	2360	3073	3212	3291
621	1053	2114	2239	2304	2365	3074	3233	3300

DISCUSSION: Bottles of CoNap promoter were inadvertently labeled as DMA promoter, and vice versa. As described in the "Fabrication Techniques" section of your *Instruction Manual*, these chemicals should be used differently, and using either one in place of the other could have serious detrimental consequences.

RECOMMENDED ACTION: Before promoting further resin or using resin that may have been promoted with CoNap and/or DMA from the affected bottles, **check any CoNap or DMA bottles you have on hand to make sure they are labeled correctly.** The chemicals are easily distinguishable by color: **CoNap is purple and DMA is amber.** Re-label any bottle that is labeled incorrectly.

If you have promoted resin using CoNap or DMA from incorrectly labeled bottles, you should discard it. If you require replacement resin, please contact the Order Desk and refer to this Service Bulletin.



MODEL	ASSEMBLY NAME	REVISION	DATE	VOLUME	PAGE
GLASAIR	SERVICE BULLETIN 148	—	11/21/96		1 of 1