

SERVICE BULLETIN 12

SUBJECT: F3416M ROD END BEARINGS

APPLICATION: Service Bulletin 12 applies to Glasair airframe kits through serial number 795. This includes kits shipped on or before 4/30/86.

DESCRIPTION: Some of the F3416M rod end bearings shipped with recent kits lack the two small inspection holes that are necessary to determine if the rod ends are threaded onto their actuator rods sufficiently.

SOLUTION:

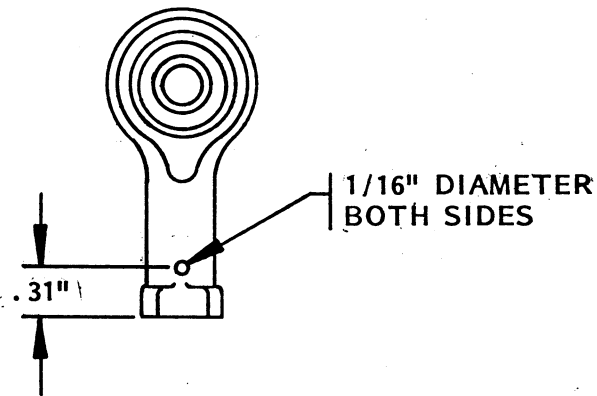


FIGURE (1)

The rod end bearings must be modified to allow inspection for adequate threading onto the rod ends. Using a 1/16" drill bit, drill holes through both sides of the rod end bearing. Locate the holes .31" from the threaded end of the bearing, as shown in FIGURE (1).



MODEL	ASSEMBLY NAME	REVISION	DATE	VOLUME	PAGE
GLASAIR	SERVICE BULLETIN 12		5/15/86		1 OF 1