

SERVICE BULLETIN 14

SUBJECT: FIXED PITCH SPINNER BACKPLATES

APPLICATION: Service Bulletin 14 applies to fixed pitch propeller spinner backplates shipped between 12/10/85 and 5/30/86.

NOTE: This bulletin does not apply to constant speed propeller spinner backplates.

DESCRIPTION: The fixed pitch propeller spinner backplates delivered during the period of time referenced above were inadvertently manufactured with the outside diameter too small. This incorrect diameter positions the backplate too far forward in the spinner which positions the spinner too far aft relative to the engine cowl.

SOLUTION: If you received a fixed pitch propeller spinner between 11/19/84 and 5/30/86, check the diameter of the backplate. If the backplate diameter at the outside of the flange is 11-1/4" ($\pm 1/16"$), it is too small. Return the backplate to us by August 31, 1986, and we will replace it for you as soon as the correctly sized backplates become available. We will not give credit for any backplates returned after August 31.



MODEL	ASSEMBLY NAME	REVISION	DATE	VOLUME	PAGE
GLASAIR	SERVICE BULLETIN 14		5/30/86		1 of 1