

# GLASTAR SERVICE BULLETIN 9


## MANDATORY

**Subject:** Rod-End Bearings (Part Number 170-0110-003)

**Applicability:** 170-0110-003 rod-end bearings shipped to GlaStar builders before 6/30/96 (through serial number 5275)


**Discussion:** The affected rod-end bearing, which is used in both the manual and the electric trim system for the GlaStar, may lack the two small inspection holes that are necessary to determine if the rod-end is threaded a sufficient distance onto its actuator rod.

**Required Action:**

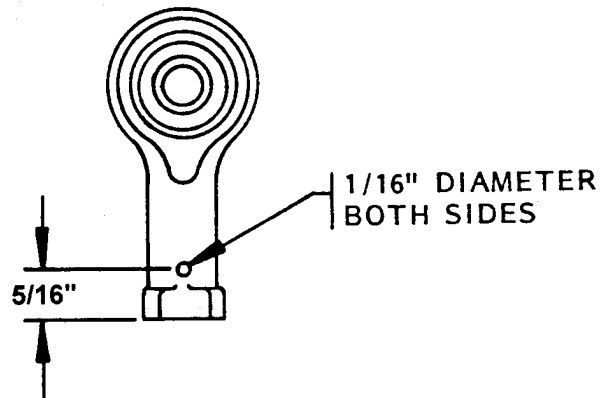

### Rod-End Bearing Modification

Any rod-end bearing without inspection holes must be modified to permit verification of adequate threading onto the control actuator rod. Using a **1/16"** bit, drill holes through both sides of the rod end bearing **5/16"** from the threaded end of the bearing, as shown.

	REVISION:	DATE: 7/29/96	PAGE: 1 of 1
---	-----------	------------------	-----------------