

GLASTAR SERVICE BULLETIN 12

MANDATORY

Subject: Possible Incorrect Clevises for the Brake Master Cylinders (P/N 090-00001-01)

Applicability: Brake master cylinders shipped before 7/8/96 (through kit serial number 5266)


Discussion: The adjustable clevises on the affected master cylinders are too short—1" long instead of 1-1/2" long. When the clevis is adjusted to achieve the specified 7-7/8" distance between the ends of the master cylinder, as described in Step 8 and shown in Figure 15 of "SECTION IX: SYSTEMS INSTALLATION" in the *Assembly Manual*, only about three threads of the clevis are engaged on the master cylinder piston rod.

Required Action: If your master cylinders were shipped before 7/8/96, measure the length of the clevis (the adjustable, forked end) on the piston rod of each one. If the clevises are only 1" long, contact us to arrange for replacement.



Note If you need replacement clevises, **you must respond by September 30, 1996.** Full price will be charged for replacement after this date.

If the clevises are 1-1/2" long, no action is required except that the clevises may need to be shortened slightly to provide the necessary adjustability. If necessary, you can remove up to 1/4" from the solid, unforked ends of the clevises, being careful to cut them off square to provide good contact surfaces for the jam nuts.

	REVISION:	DATE: 7/29/96	PAGE: 1 of 1
---	-----------	------------------	-----------------